

# Technical Bulletin

**Date:** 23rd November 2021

**Doc. No:** PAGTB701

**Product:** Mini PAGlink Gold Mount Batteries:  
MPL50 Model 7141 & MPL99 Model 7241.

**Subject:** Incompatibility between MPLG batteries and Anton/Bauer InterActive 2000 chargers with the potential for overheating or fire.

**Details:** PAG has identified a bug in the firmware of its MPL batteries that can lead, under certain circumstances, to the corruption of the protection circuit parameters. This corruption can lead to the protection system not operating as intended.

It has been observed that certain, older Anton/Bauer chargers (InterActive 2000 Series) can on occasion select an inappropriate charge program. Should these two errors present simultaneously, the consequences could be serious, with overheating and even fire.

We are not aware of any other chargers that present the same problem.

PAGlink Gold Mount Batteries HC-PL94 Model 9306 and HC-PL150 Model 9313 are not affected.

**Solution:** Mini PAGlink batteries should be updated to firmware version 3.5. or above. PAG will provide firmware update tools which will enable customers to update their battery firmware by applying the tool to the battery contacts.