

Technical Bulletin

Date: 23rd November 2021	Doc. No: PAGTB801
---------------------------------	--------------------------

Product: Mini PAGlink V-Mount Batteries:
MPL50 Model 8141 & MPL99 Model 8241.

Subject: Mini PAGlink V-Mount batteries cutting-out inappropriately when powering newer, Sony cameras.

Details: PAG has identified a bug in the firmware of its MPL batteries that can lead, under certain circumstances, to the corruption of the protection circuit parameters. This corruption can lead to the protection system not operating as intended, and may cause batteries to cut-out inappropriately during discharge. While this is not dangerous, it can be very detrimental to successful working practices. The user can rectify the problem temporarily by performing a battery reset, but this is not an effective long-term solution.

[*Link to reset information in User Guide.*](#)

The problem does not occur with PAGlink V-Mount Batteries, PL96 Models 9303 & 9304 or PL150 Models 9308 & 9309.

Solution: Mini PAGlink batteries should be updated to firmware version 3.5. or above. PAG will provide firmware update tools which will enable customers to update their battery firmware by applying the tool to the battery contacts.